

# PSC-S40N / PSC-G40N Pyrometer Series

## Self-Contained, 2 Wire Infrared Temperature Sensors



- Bright green LED or laser aiming (4 wire operation)
- Selection of temperature ranges from 250°C to 2500°C
- Integrated USB interface for sensor parameter settings
- Built-in peak picker
- Robust stainless steel housing
- USB or 24 VDC loop powered
- Graphical temperature measurement software (optional)

The innovative Process Sensors Models PSC-S40N and PSC-G40N with digital technology are compact, rugged and designed for simplicity of installation.

Used in a 2-wire loop powered configuration, the sensor's 4-20 mA linear output signal can be easily integrated into existing instrumentation for recording and process control.

The rugged stainless steel housing with protective window and cooling jacket with air purge ensures reliable operation in harsh environments.

Models PSC-S40N and PSC-G40N are suitable for mid to high temperature measurements from 250°C, with fast response time of 10 milliseconds.

The 40 Series sensors are ideal instruments for system integrators, machine builders (OEMs), and engineering construction companies.

### Typical applications:

- Steel industry
- Furnace
- Welding
- Semiconductor
- Solar
- Ceramic industry
- Metal heat treating
- Induction heating
- Rotary kilns
- Sintering

The integrated green LED or LASER facilitates accurate focusing and target alignment. The projected size of the LED is identical to the measuring spot.

Equipped with USB interface, adjustment of all sensor parameters can be accessed via a PC, such as emissivity, response time, temperature sub range, peak picker, etc.


Software is provided for IR sensor adjustments temperature measuring and data acquisition evaluation.

## TECHNICAL SPECIFICATIONS FOR PSC-S40N / PSC-G40N

TECHNICAL DATA				
Type	PSC-S40N			PSC-G40N
Temperature range	600 °C to 1800 °C	800 °C to 2500 °C	250 °C to 1300 °C	350 °C to 1800 °C
Sub temperature range	Adjustable within temperature range, minimum span 51 °C			
Spectral range	0.8 µm to 1.1 µm		1.5 µm to 1.8 µm	
Optics (refer tables)	Several fixed optics (type I, II, III and IV)			
Distance ratio	> 100 : 1			
Measurement uncertainty	0.5 % of meas. value ( $T_U = 23\text{ °C}$ , $E = 1$ , $t_{95} = 1\text{ s}$ )			
Reproducibility	0.1 % of meas. value ( $T_U = 23\text{ °C}$ , $E = 1$ , $t_{95} = 1\text{ s}$ )			
Response time (t95)	< 10 ms, adjustable up to 10 s			
Emissivity	Adjustable, 0.05 to 1.00			
Storage	Maximum value storage, adjustable via interface			
Output	4...20 mA, linear, max. load: 700 Ω at 24 V			
Interface	Galvanically isolated USB interface			
Software	PSC Spot for Windows®			
Aiming	Green LED or LASER aiming			
Parameters	Adjustable via software (emissivity, response time, temperature unit °C or °F, storage, sub range) with use of communications cable			
Power supply	24 VDC ± 25 % and 5 V to 30 VDC (LED/laser)			
Power consumption	Max. 0.6 W (without LED/laser)			
Operating temperature	0 °C to 70 °C			
Storage temperature	-20 °C to 70 °C			
Weight	approx. 16.05 oz. (455 g)			
Dimensions	Thread M40 × 1.5, length 5.51 inches (140 mm)			
Housing	Stainless steel with plug connector and protection window			
Safety class	IP 65 (DIN 40 050)			
CE-Symbol	According to EU regulations (EN 50 011)			
Scope of delivery	PSC PSC-S40N or PSC-G40N, manual, inspection sheet, PSC Spot for Windows® (without connecting cable, please order separately)			
Accessories, mechanical, electrical and optical				
Connecting cable 3-pin	Length Feet 6.5', 16', 33', 49', 65', 82', 98' (2 m, 5 m, 10 m, 15 m, 20 m, 25 m or 30 m)			
USB-connecting cable	Length 5.91 feet (1.8 m) screened			
Power supply	24 VDC, 0.6 A			
Mounting angle bracket	Fixed or adjustable			
Ball and socket mounting	Stainless steel, adjustable			
Air purge unit	Stainless steel, air pressure 0.2 to 1.0 bar, oil free			
Water cooling jacket	With integrated air purge and mounting angle			
Vacuum flange	KF 16, with quartz glass			
Protection window	Quartz glass or sapphire glass			


**Optics 210 (focussed at a = 210mm measuring distance)**

Measuring distance a in inches (mm)	0	4 (100)	<b>8.26 (210)</b>	12 (300)	15.7 (400)	19.6 (500)	23.6 (600)
Measuring field diameter M in mm							
PSC-S40N (600°C to 1800°C)	0.5 (12.5)	0.3 (7.5)	<b>0.08 (2.0)</b>	0.33 (8.2)	0.6 (15.1)	0.88 (22.0)	1.56 (28.9)
PSC-S40N (800°C to 2500°C)	0.5 (12.5)	0.28 (7.1)	<b>0.48 (1.2)</b>	0.28 (7.1)	0.54 (13.6)	0.8 (20.1)	1.06 (26.6)
PSC-G40N (250°C to 1300°C)	0.5 (12.5)	0.3 (7.5)	<b>0.08 (2.0)</b>	0.33 (8.2)	0.6 (15.1)	0.88 (22.0)	1.56 (28.9)
PSC-G40N (350°C to 1800°C)	0.5 (12.5)	0.28 (7.1)	<b>0.48 (1.2)</b>	0.28 (7.1)	0.54 (13.6)	0.8 (20.1)	1.06 (26.6)

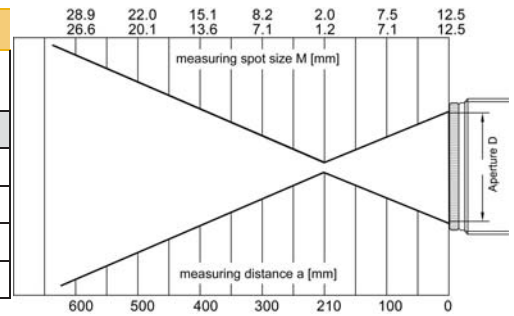


**Optics 290 (focussed at a = 290mm measuring distance)**

Measuring distance a in inches (mm)	0	4 (100)	7.9 (200)	<b>11.6 (290)</b>	15.7 (400)	19.6 (500)	23.6 (600)
Measuring field diameter M in mm							
PSC-S40N (600°C to 1800°C)	0.47 (11.8)	0.35 (8.8)	0.23 (5.7)	<b>0.12 (3.0)</b>	0.34 (8.6)	0.55 (13.7)	0.75 (18.8)
PSC-S40N (800°C to 2500°C)	0.47 (11.8)	0.33 (8.2)	0.19 (4.7)	<b>0.60 (1.5)</b>	0.26 (6.5)	0.44 (11.1)	0.63 (15.7)
PSC-G40N (250°C to 1300°C)	0.47 (11.8)	0.35 (8.8)	0.23 (5.7)	<b>0.12 (3.0)</b>	0.34 (8.6)	0.55 (13.7)	0.75 (18.8)
PSC-G40N (350°C to 1800°C)	0.47 (11.8)	0.33 (8.2)	0.19 (4.7)	<b>0.60 (1.5)</b>	0.26 (6.5)	0.44 (11.1)	0.63 (15.7)

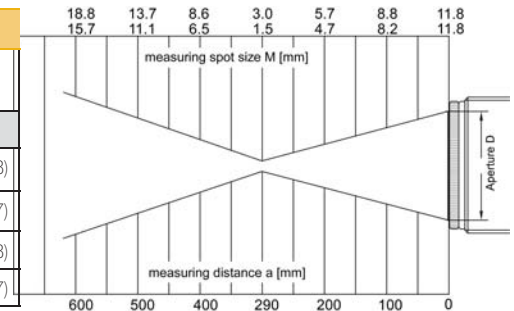


**Optics 650 (focussed at a = 650mm measuring distance)**

Measuring distance a in inches (mm)	0	7.9 (200)	15.7 (400)	<b>25.59 (650)</b>	32 (800)	40 (1000)	48 (1200)
Measuring field diameter M in mm							
PSC-S40N (600°C to 1800°C)	0.43 (10.8)	0.38 (9.5)	0.33 (8.2)	<b>0.26 (6.5)</b>	0.42 (10.5)	0.63 (15.8)	0.84 (21.1)
PSC-S40N (800°C to 2500°C)	0.43 (10.8)	0.34 (8.6)	0.25 (6.3)	<b>0.14 (3.5)</b>	0.27 (6.8)	0.45 (11.2)	0.62 (15.6)
PSC-G40N (250°C to 1300°C)	0.43 (10.8)	0.38 (9.5)	0.33 (8.2)	<b>0.26 (6.5)</b>	0.42 (10.5)	0.63 (15.8)	0.84 (21.1)
PSC-G40N (350°C to 1800°C)	0.43 (10.8)	0.34 (8.6)	0.25 (6.3)	<b>0.14 (3.5)</b>	0.27 (6.8)	0.45 (11.2)	0.62 (15.6)

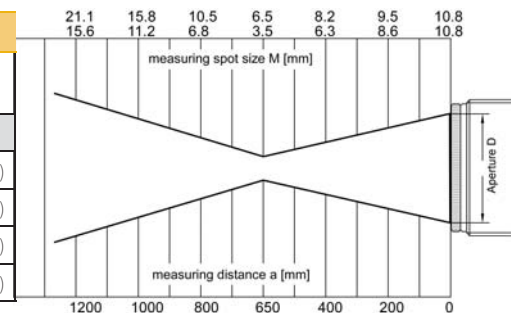


**Optics 4000 (focussed at a = 4000mm measuring distance)**

Measuring distance a in inches (mm)	0	15.7 (400)	32 (800)	64 (1600)	96 (2400)	128 (3200)	<b>160 (4000)</b>
Measuring field diameter M in mm							
PSC-S40N (600°C to 1800°C)	0.41 (10.4)	0.54 (13.4)	0.65 (16.3)	0.89 (22.2)	1.13 (28.2)	1.36 (34.1)	<b>1.6 (40)</b>
PSC-S40N (800°C to 2500°C)	0.41 (10.4)	0.56 (14.1)	0.49 (12.3)	0.57 (14.2)	0.65 (16.2)	0.72 (18.1)	<b>0.8 (20)</b>
PSC-G40N (250°C to 1300°C)	0.41 (10.4)	0.54 (13.4)	0.65 (16.3)	0.89 (22.2)	1.13 (28.2)	1.36 (34.1)	<b>1.6 (40)</b>
PSC-G40N (350°C to 1800°C)	0.41 (10.4)	0.56 (14.1)	0.49 (12.3)	0.57 (14.2)	0.65 (16.2)	0.72 (18.1)	<b>0.8 (20)</b>

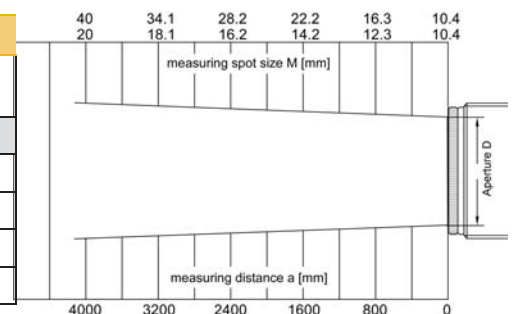


## Field of view (FOV) calculations

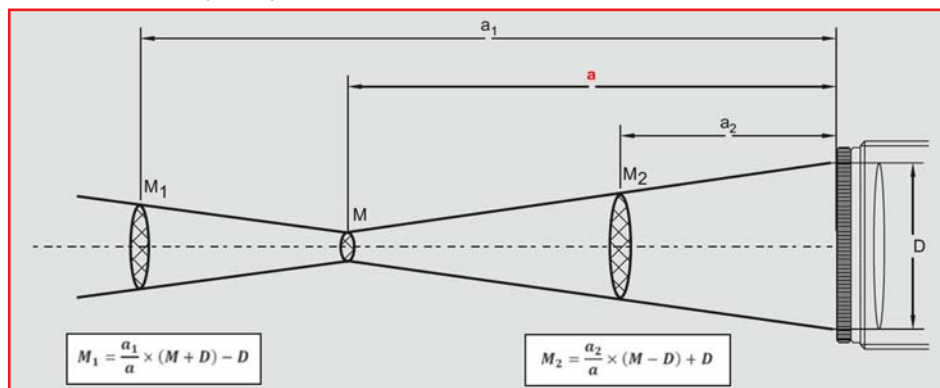


## Dimensions in MM

### Cooling Jacket & Air Purge

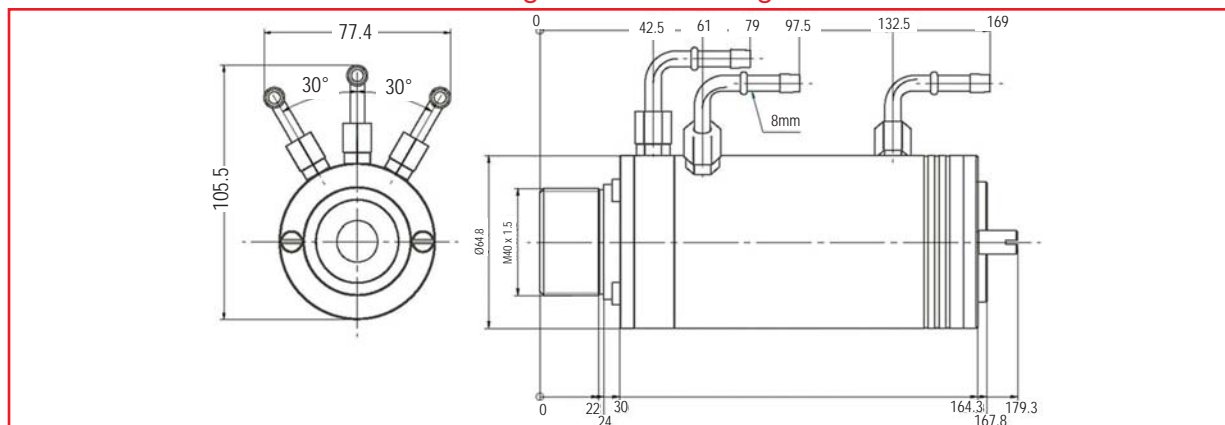

### Pyrometer

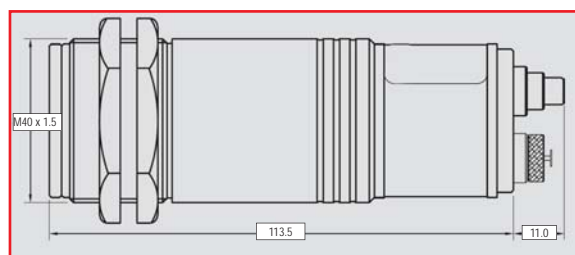

## Accessories

Adjustable mounting bracket  
PN# PSC-3310A21011



Cooling jacket with air purge  
PN# PSC-3310A23010



Air purge unit  
PN# PSC-3310A22010



Digital Display  
PN# PSC-TIC500



Power supply 24 VDC (din rail)  
PN# PSC-950-004

